DIRECTORS:
D. S. HEATHER
J. F. KELLEHER
G. I. FRANCIS
A. A. SUGAR
J. M. WEST, O.B.E.
T. P. COWELL



ASSOCIATED MOTOR CYCLES LTD.

TELEPHONE
WOOLWICH 1223
TELEGRAMS
HATCHLESS-LONDON-TELEX
CODES
ABCSTASTEMADENTLEYS
MATCHLESS-LONDON-TELEX

TELEX No. 22617

PLUMSTEAD ROAD LONDON, S.E.18

Our Ref FWN/DS

Your Ref

11th May, 1959

Messrs. England's Garage, Wraxall, Shepton Mallet, Som:

Dear Sirs,

We have received a memo from our Mr. Wallen, and we are sorry to learn that you have had trouble with a 250cc. Model in respect of lamp bulbs blowing.

The only way this fault can occur is due to a bad connection or an open circuit in the battery circuit only. If the A.C. alternator voltage is allowed to rise without going through the battery, this high voltage will, of course, cause the bulbs to blow.

Therefore the fault must be associated with either one or more of the following:

- (1) Loose battery terminals or dirty connections.
 - (2) Bad earth connection.
 - (3) Poor or loose connection in the 2-way connector in the negative battery lead.
 - (4) Loose ammeter terminal connections.

If the battery is faulty with a short in it, this, of course, will not break down the output voltage, which is another point which should have your attention.

With this letter we are sending you an Instruction Book wherein you will find a wiring diagram, which clearly shows the 2-way connector to which we refer.

Trusting you will be able to clear the fault without undue difficulty.

Yours fattingly, ASSOCIATED MOTOR CYCLES LIMITED.