

SB92

SHOP DOPE

FLYWHEEL SLIPPAGE

On several occasions, dealers have reported that where machines were used in competition or where riders had a habit of engaging their clutch too abruptly, flywheel shifting resulted.

In some cases, it was corrected and no further trouble was experienced; while, on other occasions, it was not corrected immediately and the result was that the pinion shaft, roller bearings and housing was ruined.

Late in the 1947 season, this trouble was corrected by the factory when they fitted hard steel washers and hardened nuts.

Anytime a dealer disassembles the bottom end, he should install

2	STD233	Hardened nuts
2	1570	Steel washers

In assembling, be sure the crankpin nuts are drawn up extra tight and no further trouble should be experienced.

Service Department  
ALLIED MOTORCYCLE DIST., INC.