



The INDIAN Company

Division of Associated Motor Cycles LTD.

Pioneers in American Motorcycling — 20 FIRST AVENUE, CHICOPEE FALLS, MASSACHUSETTS

LY 2-7741
Cable Address INSALCOR

July 17, 1961

Mr. Herbert Kurze
Flint Indian Sales
923 North Saginaw Street
Flint, Michigan

Dear Mr. Kurze:


The flywheel and alternator with rectifier are on the way and we hope that both will help with your problems.

The enclosed sketch and sheet will explain the changes which have been made in the alternators and what has to be done to change the wiring on the motorcycle.


We will appreciate a report of the results you obtain from the alternator set up.

Very truly yours,

THE INDIAN COMPANY

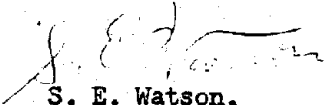
S. E. Watson,
Service Department

SEW/ly
cc: R. J. Steiner
Enclosure: (2)

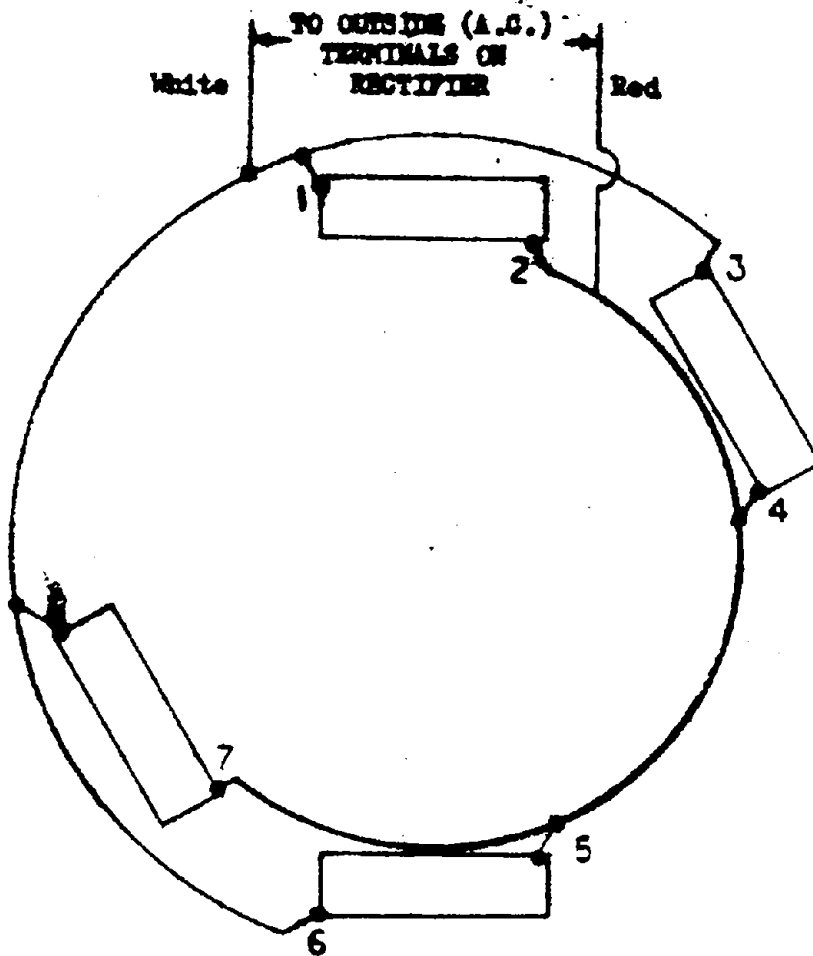

COIL CONNECTION

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8


ORIGINAL COLOR

- Translucent
- Maroon
- White
- Brown
- Red
- Ground
- Red
- Ground

CONNECT TO

- Red
- White
- White
- Red
- Red
- White
- Red
- White

G2CS ALTERNATOR COIL CONVERSION

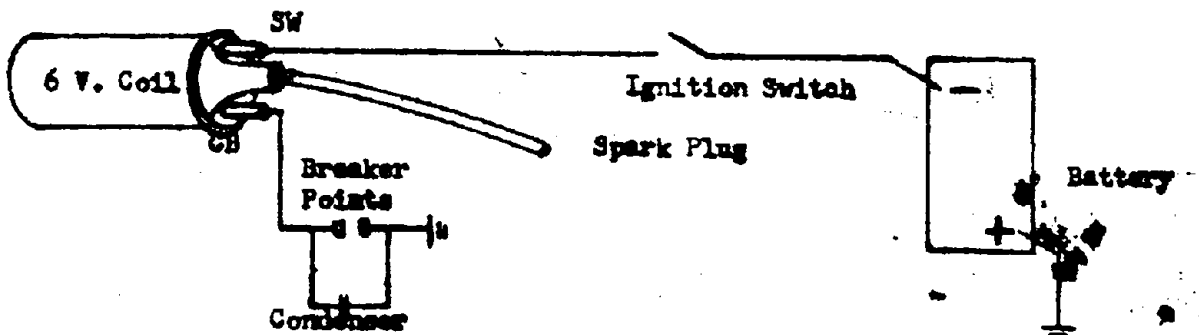

IGNITION CIRCUIT